


WS11

Elbow 11° with spigot



PE 100 SDR 11
Maximum permissible working pressure 16 bar (water) / 10 bar (gas)

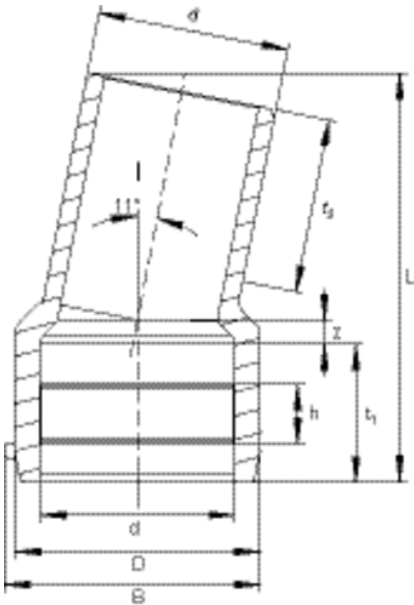

SKU	d	B	D	h	L	t ₁	t ₂	z	Weight kg	BX	PU
616139	110	151	141	32	235	79	82	14	0,920	8	144
616140	125	168	160	34	250	84	87	15	1,250	5	90
616141	160	206	200	50	295	93	98	20	2,260	8	64
616142	180	230	226	50	310	100	105	22	3,050	4	32
616143	225	284	280	50	350	114	120	24	5,280	1	18

FRIALEN safety fittings can be fused with pipes with SDR levels 11 to 17.6.

Other SDR levels available on request.

Please note the mandatory labels directly on the product.

DVGW test mark issued: DV-8606AU2249

WS11

Elbow 11° with spigot

Areas of Application

The FRIALEN Elbow WS 11° is designed for universal direction changes in HD-PE pipes even in restricted spaces. Multiple applications allow 22°, 33° etc ... elbows to be reached.

Assembly Instructions

Fusing the pipe ends to the FRIALEN Elbow WS 11° takes place by the FRIALEN fusing – leakproof and longitudinal strong. One of the pipe ends is inserted in the coupler side of the FRIALEN Elbow WS 11° and then fused, the other pipe end is connected and fused to a FRIALEN Coupler. The pipe ends are prepared (remove oxide skin and cleaning) according to the general installation instructions (see also „Assembly Instructions“ for „FRIALEN Safety Fittings for house connections and distribution pipes up to d 225“).

WS11

Elbow 11° with spigot

Good reasons for using the FRIALEN Elbow WS 11°:

- Universal direction changes due to multiple applications 11°/22°/33° or 45° + 11° ...
- Maximum flexibility in case of obstructions and in restricted spaces due to coupler/spigot design
- Long insertion depth of coupler for optimum pipe guidance (no holding device required)
- Extra wide fusion zone inside coupler
- Maximum stability due to large wall thickness
- Cold zones at the front and in the centre of the coupler
- Exposed heating coil for direct heat transfer to pipe
- Small annular gap resulting in optimum joining pressure in the fusion zone
- Contacts safe to touch
- Fusion indicator for visual fusion control
- Additional barcode for tracing back the underground fitting (Traceability-Coding)